


# 1995 Ninja® ZX™-7 PARTS DIAGRAM

Swingarm

F2141

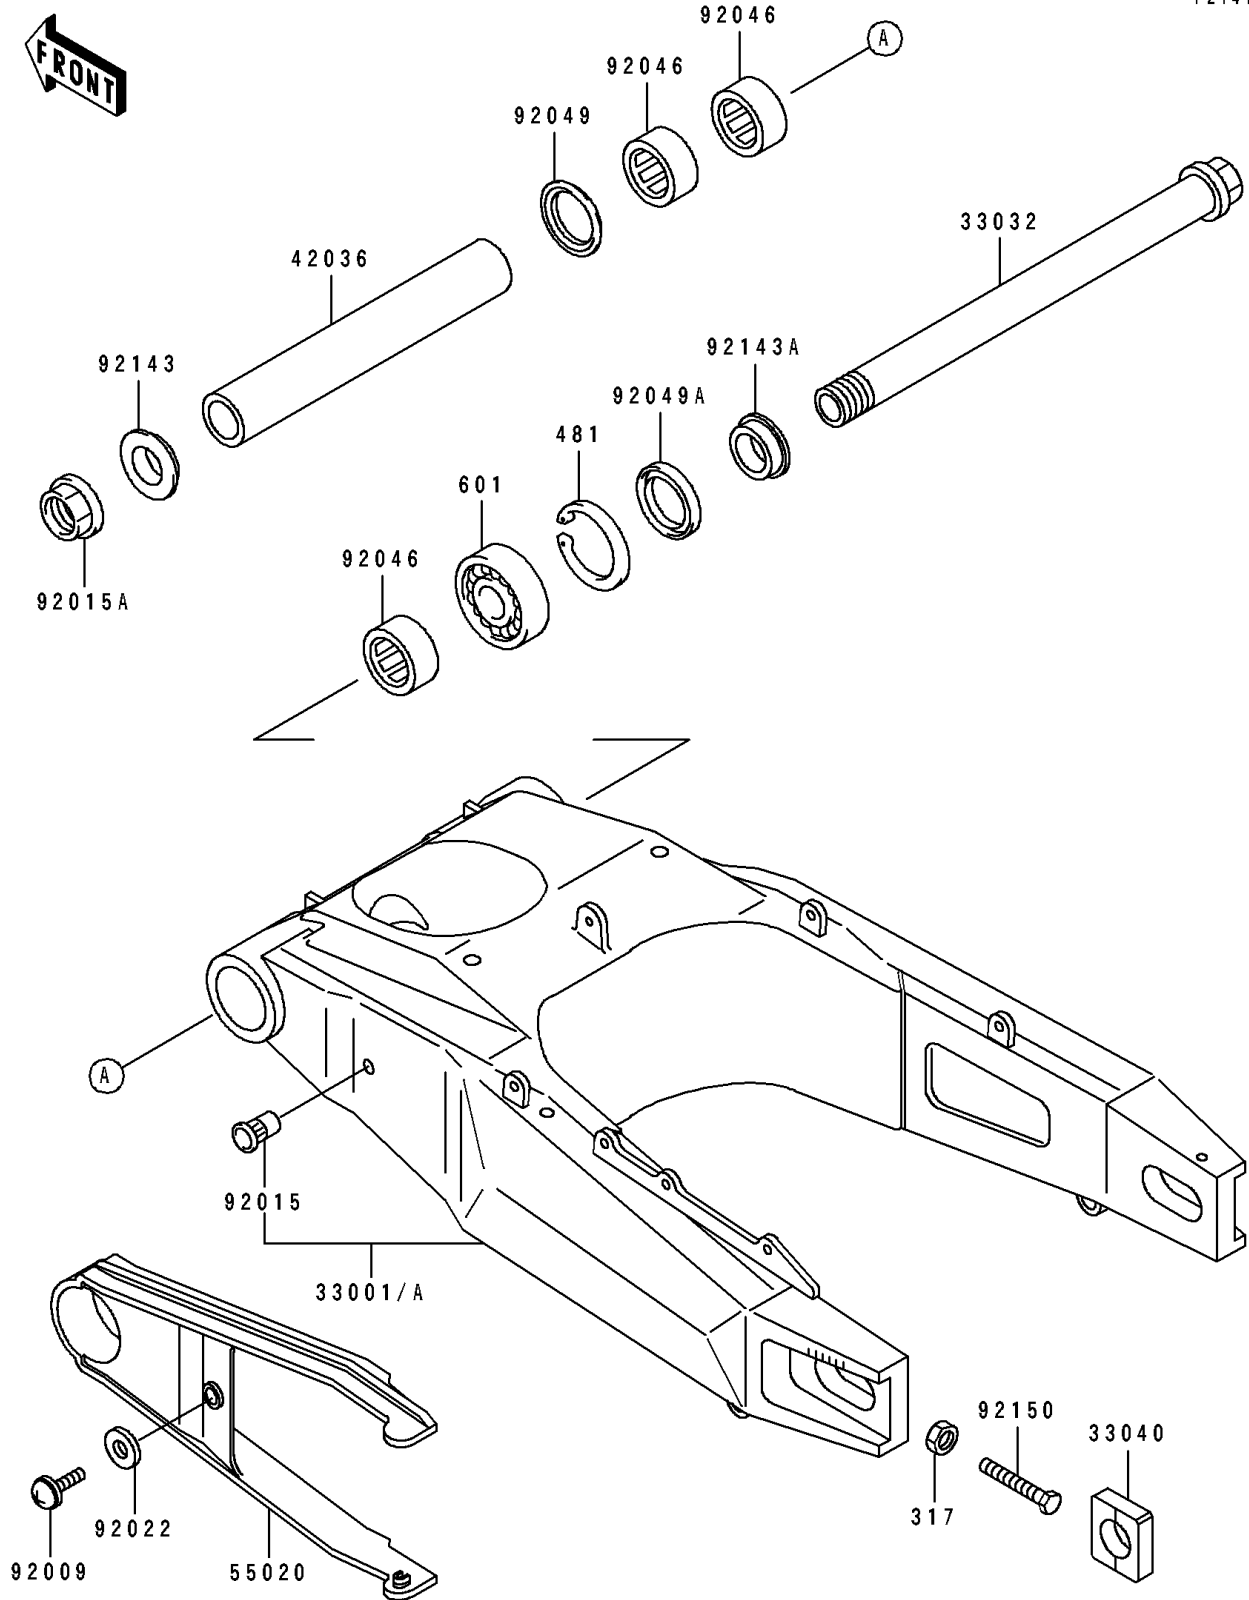

# 1995 Ninja® ZX™ -7 PARTS LIST

## Swingarm

| ITEM NAME                                 | PART NUMBER   | QUANTITY |
|---|---------------|----------|
| ARM-COMP-SWING,SILVER NO.30 (Ref # 33001) | 33001-1411-KF | 1        |
| SHAFT-SWING ARM (Ref # 33032)             | 33032-1164    | 1        |
| ADJUSTER-CHAIN (Ref # 33040)              | 33040-1114    | 2        |
| SLEEVE,SWING ARM,L=228 (Ref # 42036)      | 42036-1284    | 1        |
| GUARD,DRIVE CHAIN (Ref # 55020)           | 55020-1450    | 1        |
| SCREW,6X18 (Ref # 92009)                  | 92009-1663    | 1        |
| NUT,POP,6MM,L=16.5 (Ref # 92015)          | 92015-1792    | 1        |
| NUT,FLANGED,25MM (Ref # 92015A)           | 92015-1845    | 1        |
| WASHER,6.5X16X1 (Ref # 92022)             | 92022-1143    | 1        |
| BEARING-NEEDLE,BM3520 (Ref # 92046)       | 92046-1205    | 3        |
| SEAL-OIL,MHA 35 42 5.7F (Ref # 92049)     | 92049-1380    | 1        |
| SEAL-OIL,MHA 35 47 5 (Ref # 92049A)       | 92049-1381    | 1        |
| COLLAR,SWING ARM,LH,L=11.5 (Ref # 92143)  | 92143-1480    | 1        |
| COLLAR,SWING ARM,RH,L=12.5 (Ref # 92143A) | 92143-1481    | 1        |
| BOLT,8X55 (Ref # 92150)                   | 92150-1350    | 2        |
| NUT-HEX-SMALL,8MM (Ref # 317)             | 317G0800      | 2        |
| CIRCLIP-TYPE-C,47MM (Ref # 481)           | 481J4700      | 1        |
| BEARING-BALL,#6005U (Ref # 601)           | 601B6005U     | 1        |